

## CERTIFICATE OF CALIBRATION PRESSURE SWITCH

Certificate No. : 0499-24-HI-CAL-10B

### Customer Information

Company Name PT. Bhumi Jati Power  
Address PLTU Tanjung Jati B Unit 5&6 Tubanan, Kembang, Jepara - Jawa Tengah  
Contract No. C-BJP-24-0013-OTH

### Instrument Information

KKS No.	60LAV31CP310	Range	0.2 - 2
Instrument Description	BFPT A LUBE OIL PRESSURE LOW 2	Set	0.275
Manufacture	NAGANO KEIKI	Reset	0.478
Model	CB33	Unit	barg
Serial Number	W12110	MPE	± 0.009
Instrument Location	TURBINE 1ST FLOOR	Cal. Date	11-05-2024

### Environment Condition

Temperature 28.9 °C  
Humidity 51 % RH

### Calibration Result

Data Reading (Switch)					
As Found			As Left		
Set	Reset	Deadband	Set	Reset	Deadband
0.280	0.459	0.179	0.274	0.468	0.194
0.280	0.459	0.179	0.275	0.470	0.195
0.280	0.459	0.179	0.276	0.472	0.196

### Standard Reference


Description	Serial Number	Certificate Number	Calibration Date
Documenting Process Calibrator Fluke 754	56070038	S. 22 002 081	17-02-2022
Pressure Module Fluke 750PD4	4474073	S. 23 014 461	10-10-2023

### Calibration Method

0003/SOP\_BJS/2023  
Procedure of Calibration Pressure Switch

This certificate comprise of 1 page  
Date of issue, 12-05-2024

Customer Signature,




Ayrton Humardani Putradhi

Approved Signatory,



M. Taufiq Nur Fidiyan

Calibrated by,

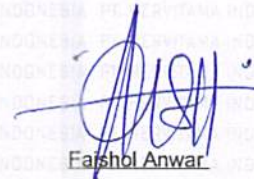

Fajhol Anwar

Sertifikat ini berlaku untuk alat dengan nama, merek dan tipe / nomor seri yang dinyatakan diatas

*This certificate applies only for the item specified above*

Dilarang mengutip, memperbanyak dan / atau mempublikasikan isi sertifikat ini tanpa izin dari PT. Hervitama Indonesia

*It is prohibited to copy, reproduce and / or publish the content of this Certificate without PT Hervitama Indonesia's approval*

\*Sertifikat ini sah bila dibubuhi cap PT. Hervitama Indonesia dan ditandatangani oleh pejabat yang berwenang

*This certificate is valid if it has approved and signed by authorized person*

